



USER MANUAL KULLANIM KILAVUZU

Megastick



EN DC WELDING INVERTER

TR DC KAYNAK İNVERTÖRÜ

(+90) 444 93 53
magmaWeld.com
info@magmaWeld.com

(+90) 538 927 12 62

Customer Service / Müşteri Hizmetleri: (+90) 444 93 53
E-Mail / E-Posta: info@magmaweld.com
Organize Sanayi Bölgesi, 5. Kısım 45030 Manisa / TURKEY

*All rights reserved. It is prohibited to reproduce this documentation, or any part thereof, without the prior written authorisation of Magma Mekatronik Makine Sanayi ve Ticaret A.Ş. Magma Mekatronik may modify the information and the images without any prior notice.
Tüm hakları saklıdır. Magma Mekatronik Makine Sanayi ve Ticaret A.Ş.'nin yazılı izni olmaksızın bu dökümanın tamamının yada bir bölümünün kopyalanması yasaktır.
Magma Mekatronik önceden haber vermeksizin bilgilerde ve resimlerde değişiklik yapılabilir.*

 **CONTENTS**

	SAFETY PRECAUTIONS	4
1	TECHNICAL INFORMATION	11
1.1	General Information	11
1.2	Machine Components	11
1.3	Product Label	12
1.4	Technical Data	13
1.5	Accessories	13
2	INSTALLATION	14
2.1	Delivery Control	14
2.2	Installation And Operation Recommendations	14
2.3	Covered Electrode And TIG Welding Connections	15
3	OPERATION	16
3.1	User Interface	16
3.2	Machine Features	16
4	MAINTENANCE AND SERVICE	17
4.1	Maintenance	17
4.2	Trouble Shooting	18
5	ANNEX 1 - SPARE PARTS LIST	19
6	ANNEX 2 - CIRCUIT CHART	20

EN

TR



SAFETY PRECAUTIONS

Be Sure To Follow All Safety Rules In This Manual!

Explanation Of Safety Information



- Safety symbols found in the manual are used to identify potential hazards.
- When any one of the safety symbols are seen in this manual, it must be understood that there is a risk of injury and the following instructions should be read carefully to avoid potential hazards.
- The possessor of the machine is responsible for preventing unauthorized persons from accessing the equipment.
- Persons using the machine must be experienced or fully trained in welding; they have to read the user manual before operation and follow the safety instructions.

Explanation Of Safety Symbols



ATTENTION

Indicates a potentially hazardous situation that could cause injury or damage. In case if no precaution is taken, it may cause injuries or material losses / damages.



IMPORTANT

Specifies notifications and alerts on how to operate the machine.




 
DANGER

Indicates a serious danger. In case if not avoided, severe or fatal injuries may occur.

Comprehending Safety Precautions

- Read the user manual, the label on the machine and the safety instructions carefully.
- Make sure that the warning labels on the machine are in good condition. Replace missing and damaged labels.
- Learn how to operate the machine, how to make the checks in a correct manner.
- Use your machine in suitable working environments.
- Improper changes made in your machine will negatively affect the safe operation and its longevity.
- The manufacturer is not responsible for the consequences resulting from the operation of the device beyond the specified conditions.

Electric Shocks May Kill

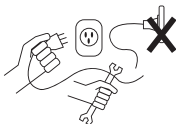

Make certain that the installation procedures comply with national electrical standards and other relevant regulations, and ensure that the machine is installed by authorized persons.

- Wear dry and sturdy insulated gloves and working apron. Never use wet or damaged gloves and working aprons.
- Do not work alone. In case of a danger make sure you have someone for help in your working environment.
- Do not touch the electrode with the bare hand. Do not allow the electrode holder or electrode to come in contact with any other person or any grounded object.
- Never touch parts that carry electricity.
- Never touch the electrode if you are in contact with the electrode attached to the work surface, floor or another machine.
- By isolating yourself from the work surface and the floor, you can protect yourself from possible electric shocks. Use a non-flammable, electrically insulating, dry and undamaged insulation material that is large enough to cut off the operator's contact with the work surface.
- Do not connect more than one electrode to the electrode holder.
- Clamp work cable with good metal-to-metal contact to workpiece or worktable as near the weld as practical.
- Do not touch electrode holders connected to two welding machines at the same time since double open-circuit voltage will be present.

- Keep the machine turned off and disconnect cables when not in use.
- Before repairing the machine, remove all power connections and/or connector plugs or turn off the machine.
- Be careful when using a long mains cable.
- Make sure all connections are tight, clean, and dry.
- Keep cables dry, free of oil and grease, and protected from hot metal and sparks.
- Bare wiring can kill. Check all cables frequently for possible damage. If a damaged or an uninsulated cable is detected, repair or replace it immediately.
- Insulate work clamp when not connected to workpiece to prevent contact with any metal object.
- Make sure that the grounding of the power line is properly connected.
- Do not use AC weld output in damp, wet, or confined spaces, or if there is a danger of falling.
- Use AC output ONLY if required for the welding process.
- If AC output is required, use remote output control if present on unit.

Additional safety precautions are required when any of the following electrically hazardous conditions are present:

- in damp locations or while wearing wet clothing,
- on metal structures such as floors, gratings, or scaffolds,
- when in cramped positions such as sitting, kneeling, or lying,
- when there is a high risk of unavoidable or accidental contact with the workpiece or ground.

For these conditions, use the following equipment in order presented:

- Semiautomatic DC constant voltage (CV) MIG welding machine,
- DC manual MMA welding machine,
- DC or AC welding machine with reduced open-circuit voltage (VRD), if available.

**Procedures for
Electric Shock**



- Turn off the electric power.
- Use non-conducting material, such as dry wood, to free the victim from contact with live parts or wires.
- Call for emergency services.

If you have first aid training;

- If the victim is not breathing, Administer cardiopulmonary resuscitation (CPR) immediately after breaking contact with the electrical source. Continue CPR (cardiac massage) until breathing starts or until help arrives.
- Where an automatic electronic defibrillator (AED) is available, use according to instructions.
- Treat an electrical burn as a thermal burn by applying sterile, cold (iced) compresses. Prevent contamination, and cover with a clean, dry dressing.

Moving Parts May Cause Injuries



- Keep away from the moving parts.
- Keep all protective devices such as covers, panels, flaps, etc., of machinery and equipment closed and in locked position.
- Wear metal toe shoes against the possibility of heavy objects falling on to your feet.

Fumes and Gases May Be Harmful To Your Health

Long-term inhalation of fumes and gases released from welding and cutting is very dangerous.



- Burning sensations and irritations in the eyes, nose and throat are signs of inadequate ventilation. In such a case, immediately boost the ventilation of the work area, and if the problem persists, stop the welding process completely.
- Create a natural or artificial ventilation system in the work area.
- Use a suitable fume extraction system where welding and cutting works are being carried out. If necessary, install a system that can expel fumes and gases accumulated in the entire workshop. Use a suitable filtration system to avoid polluting the environment during discharge.
- If you are working in narrow and confined spaces or if you are welding lead, beryllium, cadmium, zinc, coated or painted materials, use masks that provide fresh air in addition to the above precautions.
- If the gas tanks are grouped in a separate zone, ensure that they are well ventilated, keep the main valves closed when gas cylinders are not in use, pay attention to possible gas leaks.
- Shielding gases such as argon are denser than air and can be inhaled instead of air if used in confined spaces. This is dangerous for your health as well.
- Do not perform welding operations in the presence of chlorinated hydrocarbon vapors released during lubrication or painting operations.

Arc Light May Damage Your Eyes and Skin



- Use a suitable protective mask and glass filter (4 to 13 according to EN 379) suitable for that to protect your eyes and face.
- Protect other naked parts of your body (arms, neck, ears, etc.) with suitable protective clothing from these rays.
- Enclose your work area with flame-resistant folding screens and hang warning signs at eye level so that people around you will not sustain injuries from arc rays and hot metals.
- This machine is not used for heating of icebound pipes. This operation performed with the welding machine causes explosion, fire or damage to your installation.

Sparks and Spattering Particles May Get Into Eyes and Cause Damage



- Performing works such as welding, surface grinding, and brushing cause sparks and metal particles to splatter. Wear approved protective work goggles which have edge guards under the welding masks to prevent sustaining possible injuries

Hot Parts May Cause Severe Burns



- Do not touch the hot parts with bare hands.
- Wait until the time required for the machine to cool down before working on its parts.
- If you need to hold hot parts, use suitable tools, welding gloves with high-level thermal insulation and fire-resistant clothes.

Noise May Cause Damage To Your Hearing Ability



- The noise generated by some equipment and operations may damage your hearing ability.
- Wear approved personal ear protective equipment if the noise level is high.

Welding Wires Can Cause Injuries



- Do not point the torch towards any part of the body, other persons, or any metal while unwrapping the welding wire.
- When welding wire is run manually from the roller especially in thin diameters the wire can slip out of your hand, like a spring or can cause damage to you or other people around, therefore you must protect your eyes and face while working on this.

Welding Operations May Cause Fire and Explosion



- Never perform welding work in places near flammable materials. There may be fire or explosions.
- Before starting the welding work, remove these materials from the environment or cover them with protective covers to prevent combustions and flaring.
- National and international special rules apply in these areas.
- Do not apply welding or cutting operations into completely closed tanks or pipes.
- Before welding to tanks and closed containers, open them, completely empty them, and clean them. Pay the greatest attention possible to the welding operations you will perform in such places.
- Do not weld in tanks and pipes which might have previously contained substances that may cause explosions, fires or other reactions.
- Welding equipment heats up. For this reason, do not place it on surfaces that could easily burn or be damaged!
- Welding sparks can cause fire. For this reason, keep materials such as fire extinguishers tubes, water, and sand in easily accessible places.
- Use holding valves, gas regulators and valves on flammable, explosive and compressed gas circuits. Make sure that they are periodically inspected and pay attention that they run reliably.

Maintenance Work Performed by Unauthorized Persons To Machines and Apparatus May Cause Injuries



- Electrical equipment should not be repaired by unauthorized persons. Errors occurred if failed to do so may result in serious injury or death when using the equipment.
- The gas circuit elements operate under pressure; explosions may occur as a result of services provided by unauthorized persons, users may sustain serious injuries.
- It is recommended to perform technical maintenance of the machine and its auxiliary units at least once a year.

Welding In Small Sized and Confined Spaces



- In small-sized and confined spaces, absolutely make sure to perform welding and cutting operations, accompanied by another person.
- Avoid performing welding and cutting operations in such enclosed areas as much as possible.

Failure To Take Precautions During Transport May Cause Accidents



- Take all necessary precautions when moving the machine. The areas where the machine to be transported, parts to be used in transportation and the physical conditions and health of the person carrying out the transportation works should be suitable for the transportation process.
- Some machines are extremely heavy; therefore, make sure that the necessary environmental safety measures are taken when changing their places.
- If the welding machine is to be used on a platform, it must be checked that this platform has suitable load bearing limits.
- If it is to be transported by means of a haulage vehicle (transport trolley, forklift etc.), make sure of the durability of the vehicle, and the connection points (carrying suspenders, straps, bolts, nuts, wheels, etc.) that connect the machine to this vehicle.
- If the machine will be carried manually, make sure the durability of the machine apparatuses (carrying suspenders, straps, etc.) and connections.
- Observe the International Labor Organization's rules on carriage weights and the transport regulations in force in your country in order to ensure the necessary transport conditions.

- Always use handles or carrying rings when relocating the power-supply sources.
- Never pull from torches, cables or hoses. Be absolutely sure to carry gas cylinders separately.
- Remove all interconnections before transporting the welding and cutting equipment, each being separately, lift and transport small ones using its handles, and the big ones from its handling rings or by using appropriate haulage equipment, such as forklifts.

Falling Parts May Cause Injuries



Improper positioning of the power-supply sources or other equipment can cause serious injury to persons and physical damage to other objects.

- Place your machine on the floor and platforms with a maximum tilt of 10° so that it does not fall or tip over. Choose places that do not interfere with the flow of materials, where there is no risk of tripping over on cables and hoses; yet, large, easily ventilatable, dust-free areas. To prevent gas cylinders from tipping over, on machines with a gas platform suitable for the tanks, fix the tanks on to the platform; in stationary usage applications, fix them to the wall with a chain in a way that they would not tip over for sure.
- Allow operators to easily access settings and connections on the machine.

Excessive Use Of The Machine Causes Overheating



- Allow the machine to cool down according to operation cycle rates.
- Reduce the current or operation cycle rate before starting the welding again.
- Do not block the fronts of air vents of the machines.
- Do not put filters that do not have manufacturer approvals into the machine's ventilation ports.

Excessive Use Of The Machine Causes Overheating



- This device is in group 2, class A in EMC tests according to TS EN 55011 standard.
- This class A device is not intended for use in residential areas where electrical power is supplied from a low-voltage power supply. There may be potential difficulties in providing electromagnetic compatibility due to radio frequency interference transmitted and emitted in such places.
- This device is not compliant with IEC 61000 -3-12. In case if it is desired to be connected to the low voltage network used in the home, the installer to make the electrical connection or the person who will use the machine must be aware that the machine has been connected in such a manner; in this case the responsibility belongs to the user.
- Make sure that the work area complies with electromagnetic compatibility (EMC). Electromagnetic interferences during welding or cutting operations may cause undesired effects on your electronic devices and network; and the effects of these interferences that may occur during these operations are under the responsibility of the user.
- If there is any interference, to ensure compliance; extra measures may be taken, such as the use of short cables, use of shielded (armored) cables, transportation of the welding machine to another location, removal of cables from the affected device and/or area, use of filters or taking the work area under protection in terms of EMC.
- To avoid possible EMC damage, make sure to perform your welding operations as far away from your sensitive electronic devices as possible (100m).
- Ensure that your welding and/or cutting machine has been installed and situated in its place according to the user manual.

Evaluation Of Electromagnetic Suitability Of The Work Area



According to article 5.2 of IEC 60974-9;

Before installing the welding and cutting equipment, the person in charge of the operation and/or the user must conduct an inspection of possible electromagnetic interference in the environment. Aspects indicated below has to be taken into consideration;

- a) Other supply cables, control cables, signal and telephone cables, above and below the welding machine and its equipment,
- b) Radio and television transmitters and receivers,
- c) Computer and other control hardware,
- d) Critical safety equipment, e.g. protection of industrial equipment,
- e) Medical apparatus for people in the vicinity, e.g. pacemakers and hearing aids,
- f) Equipment used for measuring or calibration,
- g) Immunity of other equipment in the environment. The user must ensure that the other equipment in use in the environment is compatible. This may require additional protection measures.
- h) Considering the time during which the welding operations or other activities take place during the day, the boundaries of the investigation area can be expanded according to the size of the building, the structure of the building and other activities that are being performed in the building.

In addition to the evaluation of the field, evaluation of device installations may also be necessary for solving the interfering effect.

In case if deemed necessary, on-site measurements can also be used to confirm the efficiency of mitigation measures. (Source: IEC 60974-9).

Electromagnetic Interference Reduction Methods



- The appliance must be connected to the electricity supply in the recommended manner by a competent person. If interference occurs, additional measures may be applied, such as filtering the network.

The supply of the fixed-mounted arc welding equipment must be made in a metal tube or with an equivalent shielded cable. The housing of the power supply must be connected and a good electrical contact between these two structures has to be provided.

- The recommended routine maintenance of the appliance must be carried out. All covers on the body of the machine must be closed and/or locked when the device is in use. Any changes, other than the standard settings without the written approval of the manufacturer, cannot be modified on the appliance. Otherwise, the user is responsible for any consequences that may possibly occur.
- Welding cables should be kept as short as possible. They must move along the floor of the work area, in a side by side manner. Welding cables should not be wound in any way.
- A magnetic field is generated on the machine during welding. This may cause the machine to pull metal parts on to itself. To avoid this attraction, make sure that the metal materials are at a safe distance or fixed. The operator must be insulated from all these interconnected metal materials.
- In cases where the workpiece cannot be connected to the ground due to electrical safety, or because of its size and position (for example, in building marine vessel bodies or in steel construction manufacturing), a connection between the workpiece and the grounding may reduce emissions in some cases, it should be kept in mind that grounding of the workpiece may cause users to sustain injuries or other electrical equipment in the environment to break down. In cases where necessary, the workpiece and the grounding connection can be made as a direct connection, but in some countries where direct connection is not permissible, the connection can be established using appropriate capacity elements in accordance with local regulations and ordinances.
- Screening and shielding of other devices and cables in the work area can prevent aliasing effects. Screening of the entire welding area can be evaluated for some specific applications.

Arc Welding May Cause Electromagnetic Field (EMF) The electrical current passing through any conductor generates zonal electric and magnetic fields (EMF). All welders must follow the following procedures to minimize the risk of exposure to EMF from the welding circuit;



- In the name of reducing the magnetic field, the welding cables must be assembled and secured as far as possible with the joining materials (tape, cable ties etc.).
- The welder's/worker's body and head should be kept as far away from the welding machine and cables as possible,
- Welding and electric cables should not be wrapped around the body of the machine in any way,
- The body of the machine should not get caught between the welding cables. The source cables must be kept away from the body of the machine, both being placed side by side,
- The return cable must be connected to the workpiece as close as possible to the welded area,
- The welding machine should not rest against the power unit, enconce on it and not work too close to it,
- Welding work should not be performed when carrying the welding wire supply unit or welding power unit.

EMF may also disrupt the operation of medical implants (materials placed inside the body), such as pacemakers. Protective measures should be taken for people who carry medical implants. For example, access limitation may be imposed for passers-by, or individual risk assessments may be conducted for welders. Risk assessment should be conducted and recommendations should be made by a medical professional for users who carry medical implants.

Protection

- Do not expose the machine to rain, prevent the machine from splashing water or pressurized steam.



Energy Efficiency

- Choose the welding method and welding machine for the welding work you are to perform.
- Select the welding current and/or voltage to match the material and thickness you are going to weld.
- If you have to wait for a long time before you start your welding work, turn off the machine after the fan has cooled it down. Our machines (our products) with smart fan control will turn off on their own.



Waste Procedure

- This device is not domestic waste. It must be directed to recycling within the framework of the European Union directive and national laws.
- Obtain information from your dealer and authorized persons about the waste management of your used machines.





TECHNICAL INFORMATION

1.1 General Information

MEGASTICK is an easy-to-carry 200A welding machine with direct current output (DC), produced with single-phase inverter technology, capable of burning a shielded metal arc up to 4.00 mm.

It can also be used as a DC TIG welding machine by the arc start method by touching the tungsten end's workpiece with a TIG Torch with valve. * It is compatible with working with generator. It can also be used with welding cables up to 25 meters long. Fan cooled and thermally protected against overheating.

(*) For more information on TIG welding, see page 14.

1.2 Machine Components

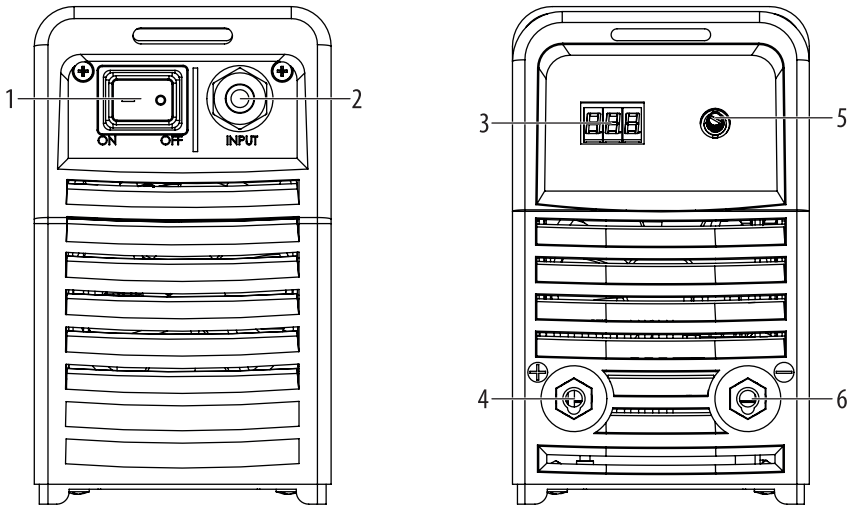

 

 










Figure 1: MEGASTICK


- 1- On/Off Power Switch
- 2- Supply Cable Entry
- 3- Digital Display

- 4- Welding and Grounding Cable Socket (+)
- 5- Current Adjustment Knob
- 6- Welding and Grounding Cable Socket (-)

1.3 Product Label

MAGMA MEKATRONİK MAKİNE SAN. VE TİC. A.Ş.			
Organize Sanayi Bölgesi 5.Kısım Manisa-TÜRKİYE			
MEGASTICK		Seri No :	
10A / 20.4V - 200A / 28V			
		X	14% 60% 100%
	$U_0 = 75V$	I_2	200A 100A 85A
	$U_1 = 230V$	I_1	42.1A 19.8A 15.6A
1 ~ 50-60 Hz		S_1	9.68 kVA 4.55kVA 3.59kVA
	IP23S		

	Mono Phase Static Frequency Converter Transformer Rectifier
	Shielded Metal Arc Welding
	Direct Current
	Vertical Characteristic
	Mains Input- Mono Phase Alternating
	Suitable for Working in Hazardous Environments
X	Operation Cycle
U_0	Open-Circuit Voltage
U_1	Supply Voltage and Frequency
U_2	Conventional Charge Voltage
I_1	Rated Supply Current
I_2	Rated Welding Current
IP23S	Protection Class
S_1	Power Drawn From The Mains

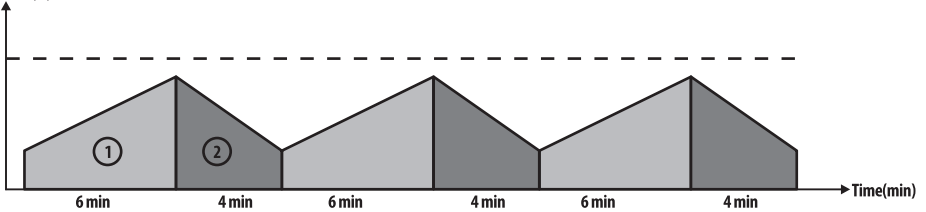Working Cycle
Temperature (°C)

As defined in the standard EN 60974-1, the operating cycle rate includes a time period of 10 minutes. For example, if a machine specified as 250A at %60 is to be operated at 250A, the machine can weld without interruption in the first 6 minutes of the 10 minutes period (zone 1). However, the following 4 minutes should be kept idle for the machine cool down (zone 2).

1.4 Technical Data

TECHNICAL DATA	UNIT	VALUE
Mains Voltage (1 Phase - 50-60 Hz)	V	230
Power Drawn from the Mains (%14)	kVA	9,68
Current Drawn from the Mains (%14)	A	42,1
Power Factor		0,67
Idle Voltage	VDC	75
Welding Current Setting Range	ADC	10-200
Rated Welding Current (%14)	ADC	200
Protection Class		IP23S
Cooling System		Air
Dimensions (LxWxH)	mm	360x120x200
Weight	kg	5
Fuse	A	50
Standards And Approval		CE,EN60974-1,EN60974-10

1.5 Accessories

STANDARD ACCESSORIES

Megastick

(For The Boxed Version)

	PIECE	PRODUCT CODE
Elektrode Clamp and Cable	1	7906102502
Grounding Pliers and Cable	1	7905102502

Megastick Deluxe

(For The Briefcase Version)

	PIECE	PRODUCT CODE
Electrode Clamp and Cable	1	7906102502
Grounding Pliers and Cable	1	7905102502
Wire Brush / Hammer	1	8369000175
Handheld Mask	1	8502301007
Elektrode (Package)	1	11101NAEM1



INSTALLATION

2.1 Delivery Control

Make sure that all the materials you have ordered have been received. If any material is missing or damaged, contact your place of purchase immediately.

The standard box includes the following:

- Main machine and connected mains cable
- Grounding clamps and cable
- Electrode clamps and cable
- Strap Belt
- Arranty certificate
- User manual

The standard bag version includes:

- Main machine and connected mains cable
- Grounding clamps and cable
- Electrode clamps and cable
- Wire Brush / Hammer
- Welding hand mask
- User manual
- Electrode (1 pack)
- Strap Belt
- Arranty certificate

In case of a damaged delivery, record a report, take a picture of the damage and report to the transport company together with a photocopy of the delivery note. If the problem persists, contact the customer service.

Symbols and their meanings on the device;



Welding process is dangerous. Proper working conditions should be ensured and necessary precautions should be taken. Specialists are responsible for the machine and have to be equipped with the necessary equipment and those who are not relevant should be kept away from the welding area.



This device is not compatible with IEC 61000-3-12. If it is desired to connect to the low voltage mains used in homes, it is essential that the installer or the person who will operate the machine to make the electrical connection has information on the machine's connectivity. In this case the responsibility will be assumed by the person who will perform the installation or by the operator.



The safety symbols and warning notes on the device and in the operating instructions must be observed and the labels must not be removed.



Grids are intended for ventilation. The openings should not be covered in order to provide good cooling and no foreign objects should be inserted.

2.2 Installation And Operation Recommendations

For better performance, place the machine at least 30 cm away from the surrounding objects. Pay attention to overheating, dust and moisture near the machine. Do not operate the machine under direct sunlight. If the ambient temperature exceeds 40°C, operate the machine at a lower current or a lower operating cycle.

Avoid welding outdoors in windy and rainy weather circumstances. If welding is necessary in such cases, protect the welding area and the welding machine with a curtain and canopy.

If you weld indoors, use a suitable smoke extraction system. Use breathing apparatus if there is a risk of inhaling welding fumes and gas in confined spaces.

Observe the operating cycle rates specified on the product label. Suspending operating cycle rates can damage the machine and this may invalidate the warranty. Use the fuse that is compliant with your system.

Tighten the ground wire as close as possible to the welding area. Do not allow the welding current to pass through equipment other than the welding cables.

If TIG is to be applied with a plug torch, secure the gas cylinder in a way not causing any hazards.

The welding cables and the mains cable must not be wrapped in the machine housing during operation.

2.3 Covered Electrode And TIG Welding Connections



Check the mains voltage before connecting the machine to the mains.

When plugging the power plug into the outlet, make sure that the power switch is set to "0" in the turned-off position.

For covered electrode welding;

- Start the machine with the on / off switch (1) and check to see that the cooling fan is working or not. Insert the welding and grounding cable into the welding and grounding cable sockets (4-6) according to the electrode to be used and poles that are recommended by the manufacturer of the electrode. Make sure to tighten them by wringing them towards clockwise.
- Connect the ground pliers to the workpiece as close as possible to the welding area.

For TIG welding;

- Start the machine with the On/Off Power Switch (1) and check to see that the cooling fan is working or not.
- A TIG torch with a gas valve has to be used.
- Connect the power cable of the TIG torch to the negative pole socket (6) and connect the grounding cable to the positive pole socket (4).
- Connect the argon gas regulator to the argon gas tank.
- Connect the gas hose of the torch to the gas regulator.

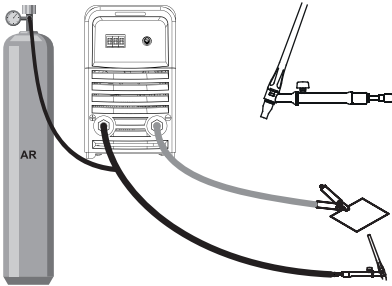


Figure 2: TIG Welding Connections

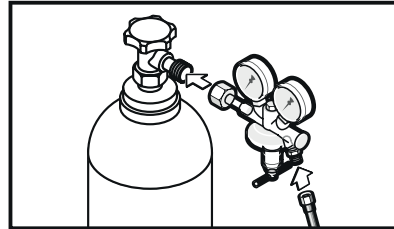


Figure 3: Gas Cylinder Connection


The following table is a reference for the amperage setting of non-alloy steels. Please make sure to follow the recommendations of the electrode manufacturer at all times.



Covered Electrode Diameter (mm)	Recommended Welding Current	
	Rutile	Basic
2.0	40-60 A	-
2.5	60-90 A	60-90 A
3.2	100-140 A	100-130 A
4.0	140-180 A	140-180 A



OPERATION

 3.1 User Interface

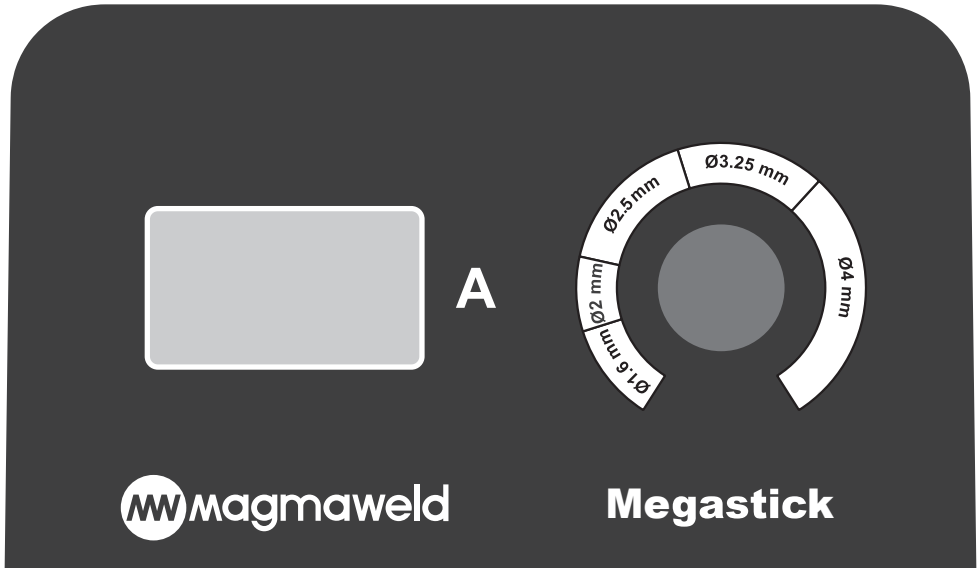

	The Megastick control panel with its user-friendly interface includes digital display and a current adjustment pod.
	Digital Display <ul style="list-style-type: none"> Current during welding are monitored from the digital display.
	Current Adjustment Pod <ul style="list-style-type: none"> There is a current setting scale around the current setting pot. With this current setting scale you can select the electrode diameter you want to burn.

3.2 Machine Features

- It is an MMA light weight, portable machine that can perform welding works in the range of 10-200 A, and it is very high in performance compared to its size.
- Its rutile and basic electrode performances are excellent.
- Weighs 5 kg and it has small, compact size.
- Fully meets EMC testing and CE requirements.
- The kVA value for the generator to be selected should be determined by checking the technical specifications of the machine (Page 12).



MAINTENANCE AND SERVICE

- Maintenance and repairs to the machine must be carried out by a qualified personnel.
- Our company will not be responsible for any accidents that may occur by unauthorized interventions.
- Parts that will be used during repair can be obtained from our authorized services. The use of original spare parts will extend the life of your machine and prevent performance losses.
- Always contact the manufacturer or an authorized service specified by the manufacturer.
- Any unauthorized repair attempt other than by the manufacturer during the warranty period will cause all warranty provisions to be void.
- Always comply with the applicable safety regulations during maintenance and repair.
- Before performing any work on the machine for repair, disconnect the machine's power plug from the power supply and wait for 10 seconds for the capacitors to discharge.

 


4.1 Maintenance




Daily Maintenance

- Do not remove the warning labels on the device. Replace the worn/tear labels with the new ones. Labels can be obtained from the authorized service.
- Check your clamps and cables. Pay attention to the connections and the durability of the parts. Replace the damaged/defective parts with the new ones. Do not ever make additions to/repair the cables.
- Ensure adequate space for ventilation.
- The supplies on the optional TIG torch must be cleaned regularly. Should be replaced if necessary. It should be ensured that these materials are original products for a long-term use.



Every 6 Months

- Clean and tighten fasteners such as bolts and nuts.
- Check the electrode clamp and grounding clamp cables.
- Open the side covers of the machine and clean with low pressure dry air. Do not apply compressed air to electronic components at close distance

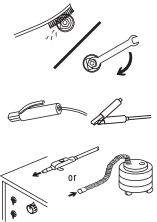

NOTE: The above mentioned periods are the maximum ones that should be applied if no problems are encountered in your device. Depending on the work load and contamination of your work environment, you can repeat the above processes more frequently.



4.2 Trouble Shooting

The following tables contain possible errors to be encountered and their solutions.

Error Code	Solution
Thermal LED on the front panel has lit up	<ul style="list-style-type: none"> • The machine's operation cycle rate may be exceeded. Wait for a while to allow the machine to cool down. If the failure disappears, try to use lower amperage values. • The fan may not be working. Inspect the fan for to see if it is functioning properly. If it is still not working, please contact the authorized service center. • The air inlet and outlet ducts may be blocked. Clear the air ducts from any blockage. • The machine operating environment can be extremely hot or airless. Have the machine placed in an environment where it can work more comfortably.
Machine does not work at all	<ul style="list-style-type: none"> • Make sure that the machine is connected to power. • Check that the mains connections are correct. • Check the mains power supply fuses, mains cable and its plug. • Check the on / off operating switch. • If you have made all the checks and if the problem still persists, please contact the authorized service center.
Machine does not weld / welds poorly	<ul style="list-style-type: none"> • Make sure that the machine's grounding pliers are connected to the workpiece. • Make sure that the cables are secure and that the connection points are not worn • Make sure that the parameter and process selection are correct. • According to the process you have chosen, follow the steps below: • Check the pole that the electrode must be connected and the current value that must be set on the machine. • Check that the gas flow is open, ensuring that the flow is accurate. • Make sure that the tungsten tip is clean. • Make sure the durability of the welding torch. • If you have made all the checks, if the problem still persists, please contact the authorized service center.

ANNEX 1 - SPARE PARTS LIST


EN

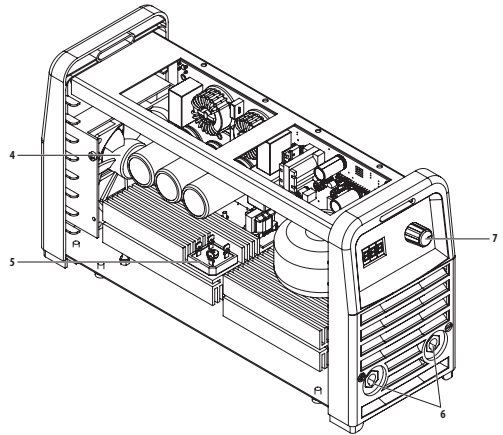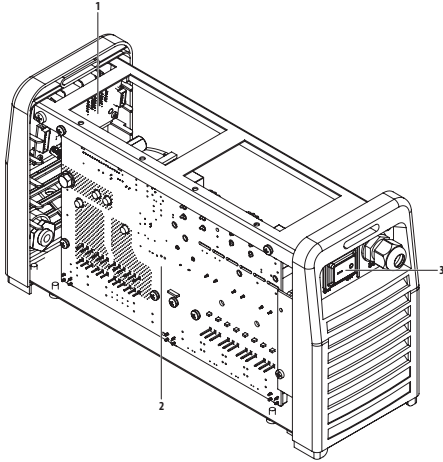

NO	DEFINITION	MATERIAL CODE
1	Electronic Card	K405000306
2	Electronic Card	K405000308
3	On/Off Switch	A310100011
4	Fan Mono	A250001024
5	Bridge Diode GBPC5010-G	A430901023
6	Welding Plug	A377900103
7	Potency Knob	A229500004
	Hall Effect Sensor	A834000001
	Electronic Card	K405000307



ANNEX 2 - CIRCUIT CHART

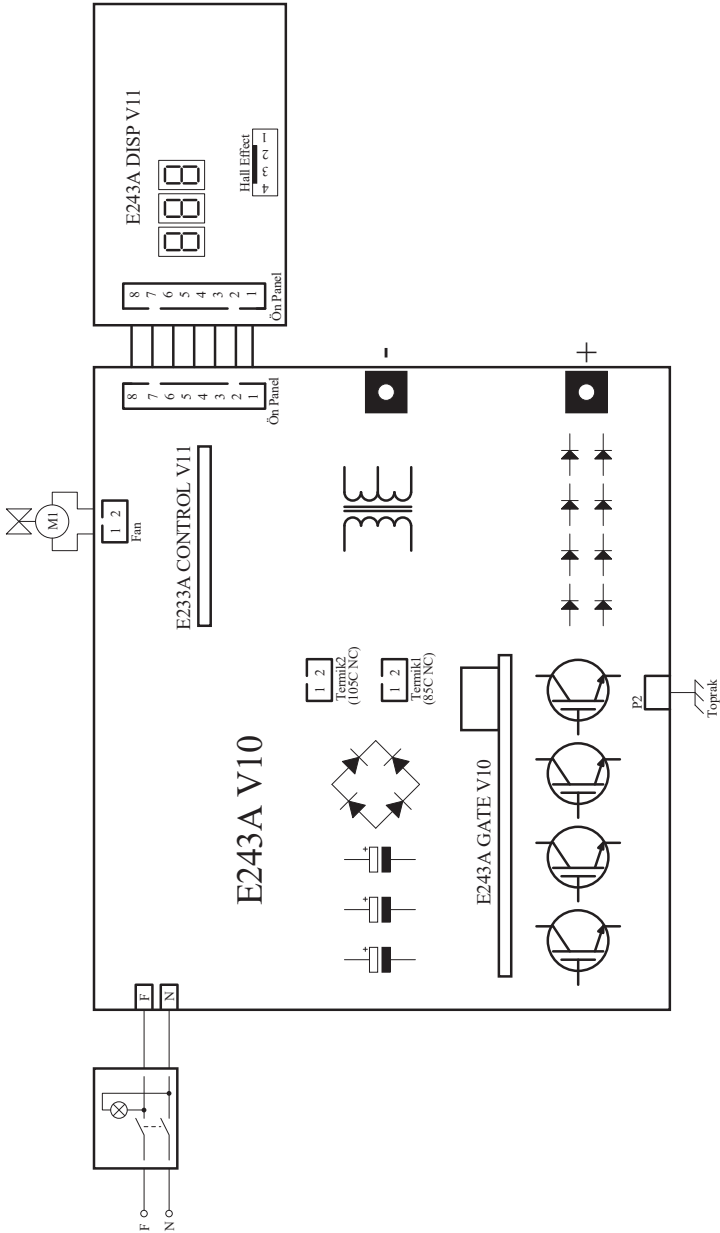

 İÇİNDEKİLER

	GÜVENLİK KURALLARI	22
1	Teknik Bilgiler	29
1.1	Genel Açıklamalar	29
1.2	Makine Bileşenleri	29
1.3	Ürün Etiketi	30
1.4	Teknik Özellikler	31
1.5	Aksesuarlar	31
2	KURULUM BİLGİLERİ	32
2.1	Teslim Alırken Dikkat Edilecek Hususlar	32
2.2	Kurulum ve Çalışma Tavsiyeleri	32
2.3	Örtülü Elektrod ve TIG Kaynağı İçin Bağlantılar	33
3	KULLANIM BİLGİLERİ	34
3.1	Kullanıcı Arayüzü	34
3.2	Makine Özellikleri	34
4	BAKIM VE ARIZA BİLGİLERİ	35
4.1	Bakım	35
4.2	Hata Giderme	36
5	EK 1 - YEDEK PARÇA LİSTESİ	37
6	EK 2 - DEVRE ŞEMASI	38

✓ GÜVENLİK KURALLARI

TR Kılavuzda Yer Alan Tüm Güvenlik Kurallarına Uyun!

Güvenlik Bilgilerinin Tanımlanması



- Kılavuzda yer alan güvenlik sembolleri potansiyel tehlikelerin tanımlanmasında kullanılır.
- Bu kılavuzda herhangi bir güvenlik sembolü görüldüğünde, bir yaralanma riski olduğu anlaşılmalı ve takip eden açıklamalar dikkatlice okunarak olası tehlikeler engellenmelidir.
- Makine sahibi, yetkisiz kişilerin ekipmana erişmesini engellemekten sorumludur.
- Makineyi kullanan kişiler kaynak konusunda deneyimli veya tam eğitilmiş kişiler olup; çalışma öncesinde kullanma kılavuzunu okumalı ve güvenlik uyarılarına uymalıdır.

Güvenlik Sembollerinin Tanımlanması



DİKKAT

Yaralanma ya da hasara neden olabilecek potansiyel tehlikeli bir durumu belirtir. Önlem alınmaması durumunda yaralanmalara veya maddi kayıplara/hasarlara neden olabilir.



ÖNEMLİ

Kullanıma yönelik bilgilendirmeleri ve uyarıları belirtir.



TEHLİKE


Ciddi tehlike olduğunu gösterir. Kaçınılması durumunda ölüm veya ağır yaralanmalar meydana gelebilir.

Güvenlik Uyarılarının Kavranması

- Kullanım kılavuzunu, makine üzerindeki etiket ve güvenlik uyarılarını dikkatli bir şekilde okuyunuz.
- Makine üzerindeki uyarı etiketlerinin iyi durumda olduğundan emin olunuz. Eksik ve hasarlı etiketleri değiştiriniz.
- Makinenin nasıl çalıştırıldığını, kontrollerinin doğru bir şekilde nasıl yapılacağını öğreniniz.
- Makinenizi uygun çalışma ortamlarında kullanınız.
- Makinenizde yapılabilecek uygunsuz değişiklikler makinenizin güvenli çalışmasına ve kullanım ömrüne olumsuz etki eder.
- Cihazın belirtilen koşullar dışında çalıştırılmasından doğan sonuçlardan üretici sorumlu değildir.

Elektrik Çarpmaları Öldürebilir

Kurulum prosedürlerinin ulusal elektrik standartlarına ve diğer ilgili yönetmeliklere uygun olduğundan emin olun ve makinenin yetkili kişiler tarafından kurulmasını sağlayın.

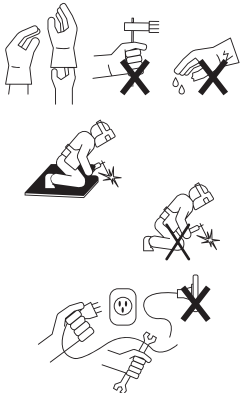

- Kuru ve sağlam izolasyonlu eldiven ve iş önlüğü giyin. Islak ya da hasar görmüş eldiven ve iş önlüklerini kesinlikle kullanmayın.
- Yanlış başınızda çalışmayın. Bir tehlike durumunda, çalıştığınız ortamda haber verebileceğiniz birinin olduğundan emin olun.
- Elektroda çıplak elle dokunmayın. Elektrod pensesinin veya elektrodun herhangi bir kişi ya da topraklanmış nesne ile temas etmesini engelleyin.
- Elektrik taşıyan parçalara kesinlikle dokunmayın.
- Eğer çalışma yüzeyine, zemine ya da başka bir makineye bağlı elektrodla temas halindeyseniz kesinlikle elektroda dokunmayın.
- Çalışma yüzeyinden ve zeminden kendinizi izole ederek olası muhtemel elektrik şoklarından koruna bilirsiniz. Çalışma yüzeyiyle operatörün temasını kesecek kadar büyük, yanmaz, elektriksel açıdan yalıtkan, kuru ve hasarsız izolasyon malzemesi kullanın.
- Elektrod pensesine birden fazla elektrod bağlamayın.
- Topraklama pensesini çalışma parçası ya da çalışma masasına metal metale iyi bir temas sağlayacak şekilde olabildiğince yakın bağlayın.
- Çift açık devre voltajı olacağı için 2 farklı makinaya bağlı elektrod penselerine aynı anda dokunmayın.

- Makineyi kullanmadığınız durumlarda kapalı tutun ve kabloların bağlantılarını sökün.
- Makineyi tamir etmeden önce tüm güç bağlantılarını ve/veya bağlantı fişlerini çıkartın ya da makineyi kapatın.
- Uzun şebeke kablosu kullanırken dikkatli olun.
- Tüm bağlantıların sıkı, temiz ve kuru olduğundan emin olun.
- Kabloların kuru, temiz olmasına ve yağlanmamasına özen gösterin. Sıcak metal parçalardan ve kıvılcıklardan koruyun.
- İzolasyonsuz, çıplak kablolar ölümcül tehlike yaratır. Tüm kabloları olası hasarlara karşı sık sık kontrol edin. Hasarlı ya da izolasyonsuz bir kablo tespit edildiğinde derhal tamir edin veya değiştirin.
- Topraklama pensesi iş parçasına bağlı değil ise herhangi bir metal nesneyle temasını önlemek için izole edin.
- Elektrik hattının topraklamasının doğru yapıldığından emin olun.
- AC kaynak çıkışı ıslak, nemli ya da sıkışık alanlarda ve düşme tehlikesi bulunan yerlerde kullanmayın.
- AC çıkışı yalnızca kaynak prosesi için gerekli olduğu durumlarda kullanın.
- AC çıkışı gerekli olduğu durumlarda eğer makinenizde mevcut ise uzaktan kontrol ünitesini kullanın.

Aşağıdaki elektriksel açıdan tehlike içeren durumlardan biri mevcut olduğunda ekstra güvenlik önlemleri alın;

- Nemli yerlerdeyken veya ıslak kıyafetler giyerken,
- Metal zemin, ızgara veya iskele yapılarında iken,
- Oturma, diz çökme veya yatma gibi sıkışık konumlarda iken,
- İş parçası veya zemine temas etme riski yüksek veya kaçınılmaz olduğunda.

Bu durumlarda aşağıdaki ekipmanlar kullanılabilir;

- Yarı otomatik DC sabit gerilim (CV) MIG kaynak makinesi,
- DC manuel örtülü elektrod kaynak makinesi,
- Var ise düşük açık devre gerilimine (VRD) sahip DC veya AC kaynak makinesi.

**Elektrik Çarpması
Durumunda
Uygulanması Gerekenler**



- Elektrik gücünü kapatın.
- Elektrik şokuna kapılmış kazazedeyi elektrik taşıyan kablo veya parçalardan kurtarmak için kuru odun gibi iletken olmayan malzemeler kullanın.

• Acil servisi arayın.

İlk yardım eğitiminiz var ise;

- Kazazede nefes alamıyorsa elektrik kaynağı ile teması kesildikten hemen sonra kalp masajı (CPR) uygulayın. Solunum başlayana veya yardım gelene kadar kalp masajına (CPR) devam edin.
- Otomatik bir elektronik defibrilatörün (AED) mevcut olduğu durumlarda talimatlara uygun şekilde kullanın.
- Elektrik yanığını termal yanık gibi soğuk kompres uygulayarak tedavi edin. Enfeksiyon kapmasını önleyin ve temiz, kuru bir örtü ile örtün.

Hareketli Parçalar Yaralanmalara Yol Açabilir

 


- Hareket halinde olan nesnelere uzak durun.
- Makine ve cihazlara ait tüm kapak, panel, kapı, vb. koruyucuları kapalı ve kilitleli tutun.
- Ağır cisimlerin düşme olasılığına karşı metal burunlu ayakkabı giyin.

Duman ve Gazlar Sağlığınız İçin Zararlı Olabilir



Kaynak ve kesme işlemi yapılırken çıkan duman ve gazın uzun süre solunması çok tehlikelidir.



- Gözlerde, burunda ve boğazda meydana gelen yanma hissi ve tahrişler, yetersiz havalandırmanın belirtileridir. Böyle bir durumda derhal havalandırmayı arttırın, sorunun devam etmesi halinde kaynak işlemini durdurun.
- Çalışma alanında doğal ya da suni bir havalandırma sistemi oluşturun.
- Kaynak ve kesme işlemi yapılan yerlerde uygun bir duman emme sistemi kullanın. Gerekirse tüm atölyede biriken duman ve gazları dışarıya atabilecek bir sistem kurun. Deşarj esnasında çevreyi kirletmemek için uygun bir filtrasyon sistemi kullanın.
- Dar ve kapalı alanlarda çalışıyorsanız veya kurşun, berilyum, kadmiyum, çinko, kaplı ya da boyalı malzemelerin kaynağını yapıyorsanız, yukarıdaki önlemlere ilave olarak temiz hava sağlayan maskeleri kullanın.
- Gaz tüpleri ayrı bir bölgede gruplandırılmışsa buraların iyi havalandırmasını sağlayın, gaz tüpleri kullanımında değilken ana vanalarını kapalı tutun, gaz kaçaklarına dikkat edin.
- Argon gibi koruyucu gazlar havadan daha yoğundur ve kapalı alanlarda kullanıldıkları takdirde havanın yerine solunabilirler. Bu da sağlığınız için tehlikelidir.
- Kaynak işlemlerini yağlama veya boyama işlemlerinde açığa çıkan klorlu hidrokarbon buharlarının olduğu ortamlarda yapmayın.

Ark Işığı Gözlerinize ve Cildinize Zarar Verebilir



- Gözlerinizi ve yüzünüzü korumak için uygun koruyucu maske ile ona uygun (EN 379'a göre 4 ila13) cam filtre kullanın.
- Vücudunuzun diğer çıplak kalan yerlerini (kollar, boyun, kulaklar, vb) uygun koruyucu giysilerle bu işinlerden koruyun.
- Çevrenizdeki kişilerin ark ışınlarından ve sıcak metallere zarar görmemeleri için çalışma alanınızı göz hizasından yüksek, alev dayanıklı paravanlarla çevirin ve uyan levhaları asın.
- Buz tutmuş boruların ısıtılmasında kullanılmaz. Kaynak makinesiyle yapılan bu işlem tesisatınızda patlama, yangın veya hasara neden olur.

Kıvılcıklar ve Sıçrayan Parçalar Gözlerinizi Yaralayabilir



- Kaynak yapmak, yüzey taşlamak, fırçalamak gibi işlemler kıvılcıklara ve metal parçacıklarının sıçramasına neden olur. Oluşabilecek yaralanmaları önlemek için kaynak maskesinin altına, kenar korumalıkları olan onaylanmış koruyucu iş gözlükleri takın.

Sıcak Parçalar Ağır Yanıklara Neden Olabilir



- Sıcak parçalara çıplak el ile dokunmayın.
- Makinenin parçaları üzerinde çalışmadan önce soğumaları için gerekli sürenin geçmesini bekleyin.
- Sıcak parçaları tutmanız gerektiğinde, uygun alet, ısı izolasyonu yüksek kaynak eldiveni ve yanmaz giysiler kullanın.

Gürültü, Duyma Yeteneğinize Zarar Verebilir



- Bazı ekipman ve işlemlerin oluşturacağı gürültü, duyma yeteneğinize zarar verebilir.
- Eğer gürültü seviyesi yüksek ise onaylanmış kulak koruyucularını takın.

Kaynak Teli Yaralanmalara**Yol Açabilir**

- Kaynak teli sargısını boşaltırken torcu vücudun herhangi bir bölümüne, diğer kişilere ya da herhangi bir metale doğru tutmayın.
- Kaynak telini makaradan elle açarken özellikle ince çaplarda tel, bir yay gibi elinizden fırlayabilir, size veya çevrenizdeki diğer kişilere zarar verebilir, bu işlemi yaparken özellikle gözlerinizi ve yüzünüzü koruyun.

Kaynak İşlemi
Yangınlara ve
Patlamalara Yol Açabilir


- Yanıcı maddelere yakın yerlerde kesinlikle kaynak yapmayın. Yangın çıkabilir veya patlamalar olabilir.
- Kaynak işlemine başlamadan önce bu maddeleri ortamdaki uzaklaştırın veya yanmalarını ve harlamalarını önlemek için koruyucu örtülerle üstlerinizi örtün.
- Bu alanlarda ulusal ve uluslararası özel kurallar geçerlidir.

- Tamamen kapalı tüplere ya da borulara kaynak ve kesme işlemi uygulamayın.
- Tüp ve kapalı konteynerlere kaynak yapmadan önce bunları açın, tamamıyla boşaltıp, havalandırıp temizleyin. Bu tip yerlerde yapacağınız kaynak işlemlerinde mümkün olan en büyük dikkati gösterin.
- İçinde daha önce, patlama, yangın ya da diğer tepkimelere neden olabilecek maddeler bulunan tüp ve borulara boş dahi olsalar kaynak yapmayın.
- Kaynak ekipmanları ısınır. Bu nedenle kolay yanabilecek veya hasar görebilecek yüzeylerin üzerine yerleştirmeyin!
- Kaynak kıvılcıkları yangına sebep olabilir. Bu nedenle yangın söndürücü tüp, su, kum gibi malzemeleri kolay ulaşabileceğiniz yerlerde bulundurun.
- Yanıcı, patlayıcı ve basınçlı gaz devreleri üzerinde geri tepme ventilleri, gaz regülatörleri ve vanalarını kullanın. Bunların periyodik kontrollerinin yapılıp sağlıklı çalışmasına dikkat edin.

Makine ve Aparatlara
Yetkisiz Kişiler Tarafından
Bakım Yapılması
Yaralanmalara
Neden Olabilir


- Elektrikli cihazlar yetkisiz kişilere tamir ettirilmemelidir. Burada yapılabilecek hatalar kullanımda ciddi yaralanmalara veya ölümlere neden olabilir.
- Gaz devresi elemanları basınç altında çalışmaktadır; yetkisiz kişiler tarafından verilen servisler sonucunda patlamalar olabilir, kullanıcılar ciddi şekilde yaralanabilir.
- Makinenin ve yan birimlerinin her yıl en az bir kez teknik bakımının yaptırılması tavsiye edilir.

Küçük Hacimli
Kapalı Alanlarda Kaynak


- Küçük hacimli ve kapalı alanlarda mutlaka bir başka kişi eşliğinde kaynak ve kesme işlemlerini yapın.
- Mümkün olduğu kadar bu tarz kapalı yerlerde kaynak ve kesme işlemleri yapmaktan kaçının.

Taşıma Esnasında
Gerekli Önlemlerin
Alınmaması
Kazalara Neden Olabilir


- Makinenin taşınmasında gerekli tüm önlemleri alınız. Taşıma yapılacak alanlar, taşımada kullanılacak parçalar ile taşımayı gerçekleştirecek kişinin fiziki koşulları ve sağlığı taşıma işlemine uygun olmalıdır.
- Bazı makineler son derece ağırdır, bu nedenle yerleri değiştirirken gerekli çevresel güvenlik önlemlerinin alındığından emin olunmalıdır.
- Kaynak makinesi bir platform üzerinden kullanılacaksa, bu platformun uygun yük taşıma sınırlarına sahip olduğu kontrol edilmelidir.
- Bir vasıta yardımı ile (taşıma arabası, forklift vb.) taşınacak ise vasıtanın ve makineyi vasıtaya bağlayan bağlantı noktalarının (taşıma askısı, kays, civata, somun, tekerlek vb.) sağlamlığından emin olunuz.
- Elle taşıma işlemi gerçekleştirilecek ise Makine aparatlarının (taşıma askısı, kays vb.) ve bağlantılarının sağlamlığından emin olunuz.

- Gerekli taşıma koşullarının sağlanması için Uluslararası Çalışma Örgütünün taşıma ağırlığı ile ilgili kurallarını ve ülkenizde var olan taşıma yönetmeliklerini göz önünde bulundurunuz .
- Güç kaynağının yerini değiştirirken her zaman tutamakları veya taşıma halkalarını kullanın. Asla torç, kablo veya hortumlardan çekmeyin. Gaz tüplerini mutlaka ayrı taşıyın.
- Kaynak ve kesme ekipmanlarını taşımadan önce tüm ara bağlantılarını sökün, ayrı ayrı olmak üzere, küçük olanları saplarından, büyükleri ise taşıma halkalarından ya da forklift gibi uygun kaldırma ekipmanları kullanarak kaldırın ve taşıyın.

Düşen Parçalar Yaralanmalara Sebep Olabilir



Güç kaynağının ya da diğer ekipmanların doğru konumlandırılmaması, kişilerde ciddi yaralanmalara ve diğer nesnelere de maddi hasara neden olabilir.

- Makinenizi düşmeyecek ve devrilmeyecek şekilde maksimum 10° eğime sahip zemin ve platformlara yerleştirin. Malzeme akışına engel olmayacak, kablo ve hortumlarla takılma riskinin oluşmayacağı, hareketsiz; ancak geniş, rahat havalandırılabilir, tozsuz alanları tercih edin. Gaz tüplerinin devrilmemesi için tüpe uygun gaz platformu bulunan makinelerde platformun üzerine, sabit kullanımlarda ise devrilmeyecek şekilde zincirle duvara sabitleyin.
- Operatörlerin makine üzerindeki ayarlara ve bağlantılara kolayca ulaşmasını sağlayın.

Aşırı Kullanım Makinenin Aşırı Isınmasına Neden Olur



- Çalışma çevrimi oranlarına göre makinenin soğumasına müsaade edin.
- Akımı veya çalışma çevrimi oranını tekrar kaynağa başlamadan önce düşürün.
- Makinenin havalandırma girişlerinin önünü kapamayın.
- Makinenin havalandırma girişlerine, üretici onayı olmadan filtre koymayın.

Ark Kaynağı Elektromanyetik Parazitlere Neden Olabilir



- Bu cihaz TS EN 55011 standardına göre EMC testlerinde grup 2, class A dir.
- Bu class A cihaz elektriksel gücün alçak gerilim şebekeden sağlandığı meskun mahallerde kullanım amacıyla üretilmemiştir. Bu gibi yerlerde iletilen ve yayılan radyo frekans parazitlerinden dolayı elektromanyetik uyumluluğu sağlamakla ilgili muhtemel zorluklar olabilir.



Bu cihaz IEC 61000 -3 - 12 uyumlu değildir. Evlerde kullanılan alçak gerilim şebekesine bağlanmak istenmesi durumunda, elektrik bağlantısını yapacak tesisatçının veya makineyi kullanacak kişinin, makinenin bağlanabilirliği konusunda bilgi sahibi olması gereklidir, bu durumda sorumluluk kullanıcıya aittir.

- Çalışma bölgesinin elektromanyetik uyumluluğa (EMC) uygun olduğundan emin olun. Kaynak veya kesme işlemi esnasında oluşabilecek elektromanyetik parazitler, elektronik cihazlarımızda ve şebekemizde istenmeyen etkilere neden olabilir. İşlem sırasında oluşabilecek bu parazitlerin neden olabileceği etkiler kullanıcının sorumluluğu altındadır.
- Eğer herhangi bir parazit oluşuyorsa, uygunluğu sağlamak için; kısa kablo kullanımı, korumalı (zırlı) kablo kullanımı, kaynak makinesinin başka bir yere taşınması, kabloların etkilenen cihaz ve/veya bölgeden uzaklaştırılması, filtre kullanımı veya çalışma alanının EMC açısından korunmaya alınması gibi ekstra önlemler alınabilir.
- Olası EMC hasarlarını engellemek için kaynak işlemlerinizi hassas elektronik cihazlarınızdan mümkün olduğunca uzakta (100m) gerçekleştirin.
- Kaynak kesme makinenizin kullanma kılavuzuna uygun şekilde kurulum yerleştirildiğinden emin olun.

Çalışma Alanının Elektromanyetik Uygunluğunun Değerlendirilmesi



IEC 60974-9 madde 5.2'ye göre;

Kaynak ve Kesme donanımı tesis etmeden önce, işletme yetkilisi ve/veya kullanıcı, çevredeki olası elektromanyetik parazitler hakkında bir inceleme yapmalıdır. Aşağıda belirtilen haller göz önünde bulundurulmalıdır;

- Kaynak makinesi ve donanımının üstünde, altında ve yanındaki diğer besleme kabloları, kontrol kabloları, sinyal ve telefon kabloları,
- Radyo ve televizyon vericileri ve alıcıları,
- Bilgisayar ve diğer kontrol donanımı,
- Kritik güvenlik donanımı, örneğin endüstriyel donanımın korunması,
- Çevredeki insanların tıbbi aparatları, örneğin kalp pilleri ve işitme cihazları,
- Ölçme veya kalibrasyon için kullanılan donanım,
- Ortamdaki diğer donanımın bağımsızlığı. Kullanıcı, çevrede kullanılmakta olan diğer donanımın uyumlu olmasını sağlamalıdır. Bu, ilave koruma önlemleri gerektirebilir,
- Kaynak işleminin ya da diğer faaliyetlerin gün içindeki gerçekleştirileceği zaman, göz önüne alınarak çevrenin büyüklüğü, binanın yapısına ve binada yapılmakta olan diğer faaliyetlere göre inceleme alanı sınırları genişletilebilir.

Alanın değerlendirilmesine ek olarak cihaz kurulumlarının değerlendirilmesi de bozucu etkinin çözümü için gerekli olabilir.

Gerek görülmesi durumunda, yerinde ölçümler azaltıcı önlemlerin verimliliklerini onaylamak için de kullanılabilir.
(Kaynak: IEC 60974-9).

Parazit Azaltma Yöntemleri



- Cihaz tavsiye edilen şekilde ve yetkili bir kişi tarafından elektrik şebekesine bağlanmalıdır. Eğer parazit oluşursa şebekenin filtrelenmesi gibi ek önlemler uygulanabilir. Sabit montajlı ark kaynağı ekipmanının beslemesi metal bir boru içerisinden veya eşdeğer ekranlı bir kablo ile yapılmalıdır. Ekran ile güç kaynağının mahfazası bağlı olmalı ve bu iki yapı arasında iyi bir elektriksel temas sağlanmalıdır.
- Cihazın tavsiye edilen rutin bakımları yapılmalıdır. Cihaz kullanımdayken, kaportanın tüm kapakları kapalı ve/veya kilitli olmalıdır. Cihaz üzerinde üreticinin yazılı onayı olmadan standart ayarları dışında herhangi bir değişiklik, modifikasyon kesinlikle yapılamaz. Aksi durumda oluşabilecek her türlü sonuçtan kullanıcı sorumludur.
- Kaynak kabloları mümkün olduğunca kısa tutulmalıdır. Çalışma alanının zemininden yan yana olacak şekilde ilerletmelidirler. Kaynak kabloları hiçbir şekilde sarılmamalıdır.
- Kaynak esnasında makinede manyetik alan oluşmaktadır. Bu durum makinenin metal parçaları kendi üzerine çekmeye sebebiyet verebilir. Bu çekimi engellemek adına metal malzemelerin güvenli mesafede veya sabitlenmiş olduğundan emin olunuz. Operatör, bütün bu birbirine bağlanmış metal malzemelerden yalıtılmalıdır.
- İş parçasının elektriksel güvenlik amacıyla veya boyutu ve pozisyonu sebebiyle toprağa bağlanmadığı durumlarda (örneğin gemi gövdesi veya çelik konstrüksiyon imalatı) iş parçası ile toprak arasında yapılacak bir bağlantı bazı durumlarda emisyonları düşürebilir. İş parçasının topraklanmasının kullanıcıların yaralanmasına veya ortamdaki diğer elektrikli ekipmanların arıza yapmasına neden olabileceği unutulmamalıdır. Gerekli hallerde iş parçası ile toprak bağlantısı doğrudan bağlantı şeklinde yapılabilir fakat doğrudan bağlantıya izin verilemeyen bazı ülkelerde bağlantı yerel düzenleme ve yönetmeliklere uygun olarak, uygun kapasite elemanları kullanılarak oluşturulabilir.
- Çalışma alanındaki diğer cihazların ve kabloların ekranlanması ve muhafazası bozucu etkilerin önüne geçilmesini sağlayabilir. Kaynak bölgesinin tamamının ekranlanması bazı özel uygulamalar için değerlendirilebilir.

Ark Kaynağı
Elektronmanyetik
Alana (EMF) Neden Olabilir



Herhangi bir iletken üzerinden geçen elektrik akımı, bölgesel elektrik ve manyetik alanlar (EMF) oluşturur.

Bütün kaynakçılar, kaynak devresinden gelen EMF'ye maruz kalmanın sebep olduğu riski en aza indirmek için aşağıdaki prosedürleri uygulamalıdır;

- Manyetik alanı azaltmak adına kaynak kabloları bir araya getirilmeli, mümkün olduğunca birleştirici malzemelerle (bant, kablo bağı vb.) emniyet altına alınmalıdır.
- Kaynakçının/çalışanın gövdesi ve başı, kaynak makine ve kablolarından mümkün olduğunca uzakta tutulmalıdır,
- Kaynak ve elektrik kabloları vücudun etrafına hiçbir şekilde sarılmamalıdır,
- Vücut, kaynak kablolarının arasında kalmamalıdır. Kaynak kablolarının her ikisi yan yana olmak üzere vücudun uzağında tutulmalıdır,
- Dönüş kablosu iş parçasına, kaynak yapılan bölgeye mümkün olduğunca yakın bir şekilde bağlanmalıdır,
- Kaynak güç ünitesine yaslanmamalı, üzerine oturmamalı ve çok yakınında çalışılmamalıdır,
- Kaynak teli besleme birimi veya kaynak güç ünitesini taşıyan kaynak yapılmamalıdır.

EMF ayrıca, kalp pilleri gibi tıbbi implantların (vücut içine yerleştirilen madde) çalışmasını bozabilir.

Tıbbi implantları olan kişiler için koruyucu önlemler alınmalıdır. Örneğin, yoldan geçenler için erişim sınırlaması koyulabilir veya kaynakçılar için bireysel risk değerlendirmeleri yapılabilir. Bir tıp uzmanı tarafından, tıbbi implantları olan kullanıcılar için risk değerlendirmesi yapıp, öneride bulunulmalıdır.

Koruma



- Makineyi yağmura maruz bırakmayın, üzerine su sıçramasına veya basınçlı buhar gelmesine engel olun.

Enerji Verimliliği



- Yapacağınız kaynağa uygun kaynak yöntemi ve kaynak makinesi tercihinde bulunun.
- Kaynak yapacağınız malzemeye ve kalınlığına uygun kaynak akımı ve/veya gerilimi seçin.
- Kaynak yapmadan uzun süre beklenilecekse, fan makineyi soğuttuktan sonra makineyi kapatın. Akıllı fan kontrolü olan makinelerimiz (ürünlerimiz) kendi kendine duracaktır.

Atık Prosedürü



- Bu cihaz evsel atık değildir. Avrupa Birliği direktifi ile ulusal yasa çerçevesinde geri dönüşüme yönlendirilmek zorundadır.
- Kullanılmış makinelerinizin atık yönetimi hakkında satıcınızdan ve yetkili kişilerden bilgi edinin.



TEKNİK BİLGİLER

1.1 Genel Açıklamalar


MEGASTICK, doğru akım çıkışlı (DC), monofaze invertör teknolojisi ile üretilmiş, 4.00 mm ye kadar örtülü elektrod yakabilen, kolay taşınabilir 200A kaynak makinesidir.

Valfli bir TIG Torcu ile tungsten ucun iş parçasına değiştirilerek ark başlatılması yöntemi ile DCTIG kaynak makinesi olarak da kullanılabilir.*

Jeneratör ile çalışmaya uyumludur. 25 metre uzunluğa kadar kaynak kablolarıyla da kullanılabilir. Fan soğutmalı ve aşırı ısınmaya karşı termik korumalıdır.

(*) TIG kaynağı hakkında daha fazla bilgi için sayfa 32 e göz atın.

1.2 Makine Bileşenleri

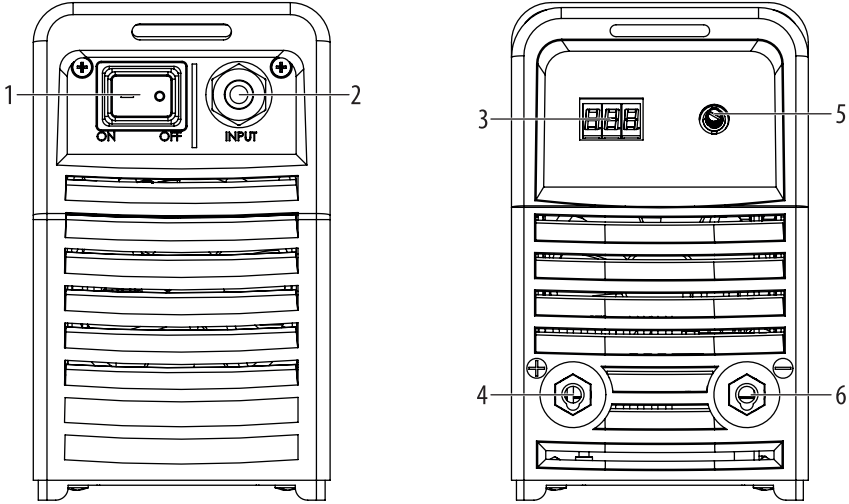

Şekil 1: MEGASTICK

1- Açma / Kapama Düğmesi

2- Besleme Kablosu Girişi

3- Dijital Gösterge

4- Kaynak ve Toprak Kablosu Soketi (+)

5- Akım Ayar Düğmesi

6- Kaynak ve Toprak Kablosu Soketi (-)

1.3 Ürün Etiketi

MAGMA MEKATRONİK MAKİNE SAN. VE TİC. A.Ş.			
Organize Sanayi Bölgesi 5.Kısım Manisa-TÜRKİYE			
MEGASTICK		Seri No :	
10A / 20.4V - 200A / 28V			
		X	14% 60% 100%
		I ₂	200A 100A 85A
		U ₂	28V 24V 23.4V
		I ₁	42.1A 19.8A 15.6A
		S ₁	9.68 kVA 4.55kVA 3.59kVA
		U ₁ =230V	I _{1max} = 42.1A I _{1eff} = 15.76A
		1 ~ 50-60 Hz	
	IP23S	CE	



Tek Fazlı Statik Frekans Çevirici
Transformatör Doğrultucu



Örtülü Elektrod Kaynağı



Doğru Akım



Düşey Karakteristik



Şebeke Girişi-1 Fazlı Alternatif Akım



Tehlikeli Ortamlarda Çalışmaya
Uygun



Çalışma Çevrimi



Boşta Çalışma Gerilimi



Şebeke Gerilimi ve Frekansı



Anma Kaynak Gerilimi



Şebekeden Çekilen Anma Akımı



Anma Kaynak Akımı




Koruma Sınıfı



Şebekeden Çekilen Güç

Çalışma Çevrimi
Sıcaklık (C°)

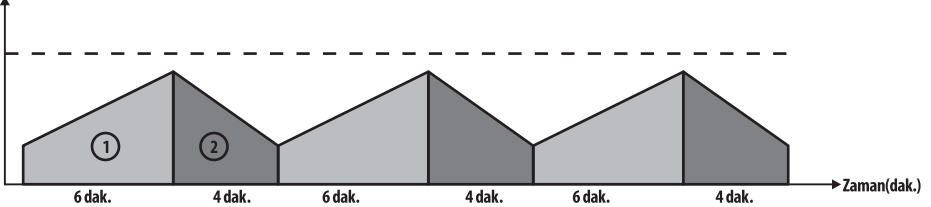

EN 60974-1 standardında da tanımlandığı üzere çalışma çevrim oranı 10 dakikalık bir zaman periyodunu içerir. Örnek olarak %60'da 250A olarak belirtilen bir makinede 250A'de çalışılmak isteniyorsa, makine 10 dakikalık zaman periyodunun ilk 6 dakikasında hiç durmadan kaynak yapabilir (1 bölgesi). Ancak bunu takip eden 4 dakika makine soğuması için boşta bekletilmelidir (2 bölgesi).

1.4 Teknik Özellikler

TEKNİK ÖZELLİKLER	BİRİM	DEĞER
Şebeke Gerilimi (1 faz - 50-60 Hz)	V	230
Şebekeden Çekilen Güç (%14)	kVA	9,68
Şebekeden Çekilen Akım (%14)	A	42,1
Güç Faktörü		0,67
Boşta Çalışma Gerilimi	VDC	75
Kaynak Akım Ayar Sahası	ADC	10-200
Anma Kaynak Akımı (%14)	ADC	200
Koruma Sınıfı		IP23S
Soğutma Sistemi		Hava
Boyutlar (UxGxY)	mm	360x120x200
Ağırlık	kg	5
Sigorta	A	50
Standart ve Onaylar		CE,EN60974-1,EN60974-10

1.5 Aksesuarlar

STANDART AKSESUARLAR

Megastick

(Kutulu Versiyon İçin)	ADET	ÜRÜN KODU
Elektrod Pensesi ve Kablo	1	7906102502
Topraklama Pensesi ve Kablo	1	7905102502

Megastick Deluxe

(Çantalı Versiyon İçin)

	ADET	ÜRÜN KODU
Elektrod Pensesi ve Kablo	1	7906102502
Topraklama Pensesi ve Kablo	1	7905102502
Tel Fırça / Çekiç	1	8369000175
El Maskesi	1	8502301007
Elektrod (Paket)	1	11101NAEM1

KURULUM BİLGİLERİ

TR

2.1 Teslim Alırken Dikkat Edilecek Hususlar

Sipariş ettiğiniz tüm malzemelerin gelmiş olduğundan emin olun. Herhangi bir malzemenin eksik veya hasarlı olması halinde derhal aldığınız yer ile temasa geçin.

Standart kutu şunları içermektedir:

- Ana makine ve ona bağlı şebeke kablosu
- Topraklama pensesi ve kablosu
- Elektrod pensesi ve kablosu
- Askı Kayışı
- Garanti belgesi
- Kullanım kılavuzu

Standart çantalı versiyon şunları içermektedir:

- Ana makine ve ona bağlı şebeke kablosu
- Topraklama pensesi ve kablosu
- Elektrod pensesi ve kablosu
- Tel fırça / Çekiç
- Kaynak el maskesi
- Kullanım kılavuzu
- Elektrod (1 paket)
- Askı Kayışı
- Garanti belgesi

Hasarlı teslimat halinde tutanak tutun, hasarın resmini çekin, irsaliyenin fotokopisi ile birlikte nakliyeciyi firmaya bildirin. Sorunun devam etmesi halinde müşteri hizmetleri ile irtibata geçin.

Cihaz üzerindeki sembol ve anlamları;



Kaynak yapma işlemi tehlike içermektedir. Uygun çalışma koşulları sağlanmalı ve gerekli önlemler alınmalıdır. Uzman kişiler makinede sorumlu olup, gerekli donanımları sağlamalıdır. İlgili olmayan kişiler kaynak sahasından uzak tutulmalıdır.



Bu cihaz IEC 61000-3-12 uyumlu değildir. Evlerde kullanılan alçak gerilim şebekesine bağlanmak istenmesi durumunda, elektrik bağlantısı yapacak tesisatçının veya makineyi kullanacak kişinin, makinenin bağlanabilirliği konusunda bilgi sahibi olması gereklidir, bu durumda sorumluluk kullanıcıya aittir.



Cihaz üzerinde ve kullanım kılavuzunda bulunan güvenlik sembollerine ve uyarı notlarına dikkat edilmeli, etiketleri sökülmemelidir.



İzgaralar havalandırma amaçlıdır. Açıklıkların üzeri iyi bir soğutma sağlamak amacıyla örtülmemelidir ve içeriye yabancı cisim sokulmamalıdır.

2.2 Kurulum ve Çalışma Tavsiyeleri

Daha iyi performans için, makineyi çevresindeki nesnelere en az 30 cm uzağa yerleştirin. Makine çevresindeki aşırı ısı, toz ve neme dikkat edin. Makineyi direk güneş ışığı altında çalıştırmayın. Ortam sıcaklığının 40 °C'yi aştığı durumlarda, makineyi daha düşük akımda ya da daha düşük çalışma çevrim oranında çalıştırın.

Dış mekanlarda rüzgar ve yağmur varken kaynak yapmaktan kaçınin. Bu tür durumlarda kaynak yapmaktan zorunluysa, kaynak bölgesini ve kaynak makinesini perde ve tenteyle koruyun. İçeride kaynak yapıyorsanız, uygun bir duman emme sistemi kullanın. Kapalı mekanlarda kaynak dumanı ve gazı soluma riski varsa, solunum aparatları kullanın.

Ürün etiketinde belirtilen çalışma çevrimi oranlarına uyun. Çalışma çevrimi oranlarını sıklıkla asmak, makineye hasar verebilir ve bu durum garantiyi geçersiz kılabilir.

Sisteminize uygun sigortayı kullanın.

Toprak kablosunun kaynak bölgesinin olabildiğince yakınına, sıkıca bağlayın.

Kaynak akımının kaynak kabloları dışındaki ekipmanlar üzerinden geçmesine izin vermeyin.

Gaz tüpünü zincirle duvara sabitleyin.

Çalışma sırasında kaynak kabloları ve şebeke kablosu makine gövdesine sarılı olmamalıdır.

2.3 Örtülü Elektrod ve TIG Kaynağı İçin Bağlantılar




Makineyi şebekeye bağlamadan önce şebekede doğru gerilimin olup olmadığını kontrol edin. Fişi prize takarken, açma kapama düğmesinin kapalı konumda "0" olduğundan emin olun.

Örtülü elektrod kaynağı için;


- Açma/kapama düğmesi (1) ile makineyi çalıştırın ve soğutma fanının çalışıp çalışmadığını kontrol edin.
- Kaynak ve topraklama kablolarını kullanılmak üzere elektroda ve elektrodun üreticisinin tavsiye ettiği kutuplara göre kaynak ve toprak kablosu soketlerine (4-6) takıp saat yönünde çevirerek sıkın.
- Toprak pensesini kaynak bölgesine olabildiğince yakın olacak şekilde iş parçasına bağlayın.

TIG kaynağı için,

- Açma/kapama düğmesi (1) ile makineyi çalıştırın ve soğutma fanının çalışıp çalışmadığını kontrol edin.
- Gaz valfli bir TIG torcu kullanılmalıdır.
- TIG torcunun güç kablosunu eksi kutuplu sokete (6) bağlayın ve topraklama kablosunu artı kutuplu sokete (4) bağlayın.
- Argon gaz regülatörünü argon gaz tüpüne bağlayın.
- Torcun gaz hortumunu gaz regülatörüne bağlayın.

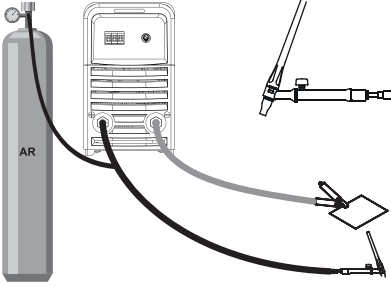

Şekil 2: TIG Kaynağı Bağlantıları

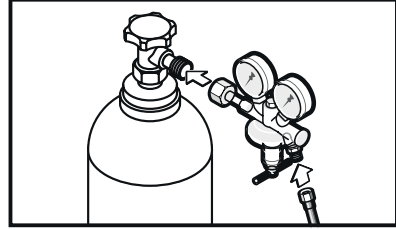

Şekil 3: Gaz Tüpü Bağlantısı

Aşağıdaki tablo alaşimsız çeliklerin amper ayarı için referans olarak verilmiştir. Lütfen elektrod üreticisinin tavsiyelerine uyunuz.


Örtülü Elektrod Çapı (mm)	Tavsiye Edilen Kaynak Akımı	
	Rutil	Bazik
2.0	40-60 A	-
2.5	60-90 A	60-90 A
3.2	100-140 A	100-130 A
4.0	140-180 A	140-180 A


 


KULLANIM BİLGİLERİ

TR

3.1 Kullanıcı Arayüzü

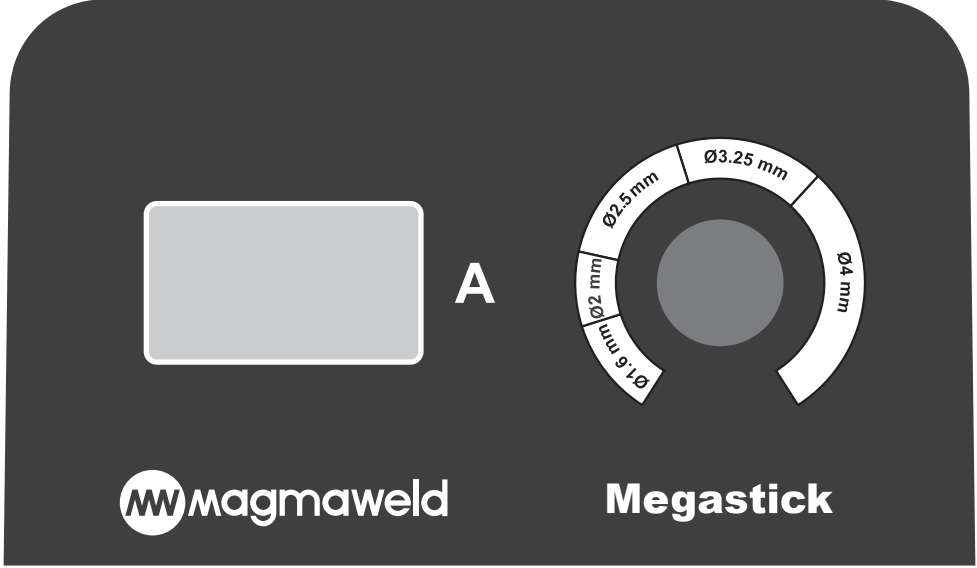

	Kullanıcı dostu arayüze sahip Megastick kontrol panelinde dijital gösterge ve akım ayar potu bulunmaktadır.
 A	Dijital Gösterge <ul style="list-style-type: none"> Akım değeri dijital panel üzerinden izlenmektedir.
	Akım Ayar Potu <ul style="list-style-type: none"> Akım ayar potunun etrafında akım ayar skalası bulunmaktadır. Bu akım ayar skalası ile yakmak istediğiniz elektrod çapını seçebilirsiniz.

3.2 Makine Özellikleri

- 10-200 A aralığında kaynak yapan hafif, taşınabilir ve performansı boyutuna göre çok yüksek olan bir MMA makinasıdır.
- Rutil ve bazik elektrod performansları mükemmeldir.
- 5 kg ağırlığa ve küçük ebatlara sahiptir.
- EMC testlerini ve CE gereksinimlerini tamamiyle karşılar.
- Jeneratörlerle çalışmaya uygundur. Seçilecek jeneratör için kVA değeri makinenin teknik özelliklerine (sayfa 30) bakılarak belirlenmelidir.



BAKIM VE ARIZA BİLGİLERİ

- Makineye yapılacak bakım ve onarımların mutlaka yetkin kişiler tarafından yapılması gerekmektedir. Yetkisiz kişiler tarafından yapılacak müdahaleler sonucu oluşacak kazalardan firmamız sorumlu değildir.
- Onarım esnasında kullanılacak parçaları yetkili servislerimizden temin edebilirsiniz. Orijinal yedek parça kullanımı makinenizin ömrünü uzatacağı gibi performans kayıplarını engeller.
- Her zaman üreticiye veya üretici tarafından belirtilen yetkili bir servise başvurun.
- Garanti süresi içerisinde üretici tarafından yetkilendirilmemiş herhangi bir girişiminde tüm garanti hükümleri geçersiz olacaktır.
- Geçerli güvenlik kurallarına bakım onarım işlemleri sırasında mutlaka uyunuz.
- Tamir için makinenin herhangi bir işlem yapılmadan önce, makinenin elektrik fişini şebekeden ayırınız ve kondansatörlerin boşalması için 10 saniye bekleyiniz.

 


4.1 Bakım




Günlük Bakım

- Cihaz üzerindeki uyarı etiketlerini sökmeyiniz. Yıpranmış/yırtılmış etiketleri yenisi ile değiştiriniz. Etiketleri yetkili servisten temin edebilirsiniz.
- Penselerin ve Kablolarınızın kontrolünü yapınız. Parçaların bağlantılarına ve sağlamlığına dikkat ediniz. Hasar görmüş/arızalı parçaları yenisi ile değiştiriniz. Kablolara ek/ onarım kesinlikle yapmayınız.
- Havalandırma için yeterli alan olduğuna emin olun.
- Opsiyonel TIG torcu üzerindeki sarf malzemeler düzenli olarak temizlenmelidir. Eğer gerekiyorsa değiştirilmelidir. Bu malzemelerin uzun ömürlü kullanılması için orjinal ürünler olmasına dikkat edilmelidir.



6 Ayda Bir

- Civata, somun gibi birleştirici parçaları temizleyiniz ve sıkıştırınız.
- Elektrod pensesi ve toprak pensesi kablolarını kontrol ediniz.
- Makinenin yan kapaklarını açarak düşük basınçlı kuru hava ile temizleyiniz. Elektronik parçalara yakın mesafeden basınçlı hava uygulamayınız.

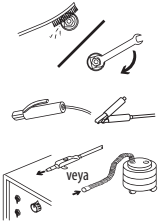

NOT: Yukarıda belirtilen süreler, cihazınızda hiçbir sorunla karşılaşılması durumunda uygulanması gereken maksimum periyotlardır. Çalışma ortamınızın yoğunluğuna ve kirliliğine göre yukarıda belirtilen işlemleri daha sık aralıklarla tekrarlayabilirsiniz.



4.2 Hata Giderme

Aşağıdaki tablolarda karşılaşılan olası hatalar ve çözüm önerileri bulunmaktadır.

TR

Hata	Çözüm
Ön paneldeki termik ledi yanıyor	<ul style="list-style-type: none"> Makinenin devrede kalma oranı aşılmış olabilir. Bir süre bekleyerek makinenin soğumasını sağlayınız. Arıza ortadan kalkıyor ise daha düşük amper değerlerinde kullanmaya çalışınız. Fan çalışmıyor olabilir. Fanın çalışıp çalışmadığını göz ile kontrol ediniz. Çalışmaması durumunda yetkili servis ile irtibata geçiniz. Hava giriş-çıkış kanallarının önü kapanmış olabilir. Hava kanallarının önünü açınız. Makine çalışma ortamı aşırı sıcak ya da havasız olabilir. Makinenin daha rahat çalışabileceği bir alana yerleştirilmesini sağlayınız.
Makine hiç çalışmıyor	<ul style="list-style-type: none"> Makinenin elektriğe bağlı olduğundan emin olunuz . Şebeke bağlantılarının doğru olduğunu kontrol ediniz. Şebeke besleme sigortalarını, şebeke kablosunu ve fişini kontrol ediniz Açma kapama anahtarını kontrol ediniz. Tüm kontrolleri yaptığınız halde sorun devam ediyor ise yetkili servis ile iletişime geçiniz.
Makine kaynak yapmıyor/ kötü yapıyor	<ul style="list-style-type: none"> Makinenin topraklama pensesinin iş parçasına bağlı olduğundan emin olunuz. Kabloların sağlamlığından ve bağlantı noktalarının aşınmamış olduğundan emin olunuz. Parametre ve proses seçiminin doğru olduğundan emin olunuz. Seçtiğiniz prosese göre aşağıdaki adımları uygulayınız: Elektrodun bağlı olması gereken kutubu ve makinede ayarlanması gereken akım değerini kontrol ediniz. Gaz akışının açık olduğunu kontrol ediniz, akışın doğru olduğundan emin olunuz. Tungsten ucun temiz olduğundan emin olunuz. Kaynak torcunun sağlamlığından emin olunuz. Tüm kontrolleri yaptığınız halde sorun devam ediyor ise yetkili servis ile iletişime geçiniz.


EK 1 - YEDEK PARÇA LİSTESİ

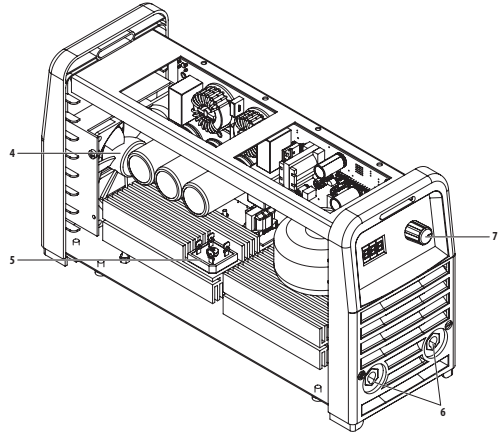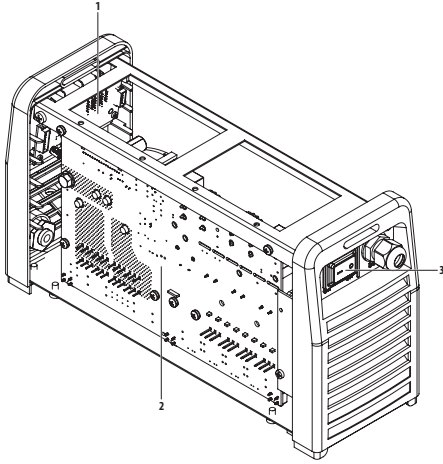

NO	TANIM	MALZEME KODU
1	Elektronik Kart	K405000306
2	Elektronik Kart	K405000308
3	Açma Kapama Anahtarı	A310100011
4	Fan Monofaz	A250001024
5	Köprü Diyot GBPC5010-G	A430901023
6	Kaynak Prizi	A377900103
7	Potans Düğmesi	A229500004
	Hall Effect Sensör	A834000001
	Elektronik Kart	K405000307

EK 2 - DEVRE ŞEMASI

TR

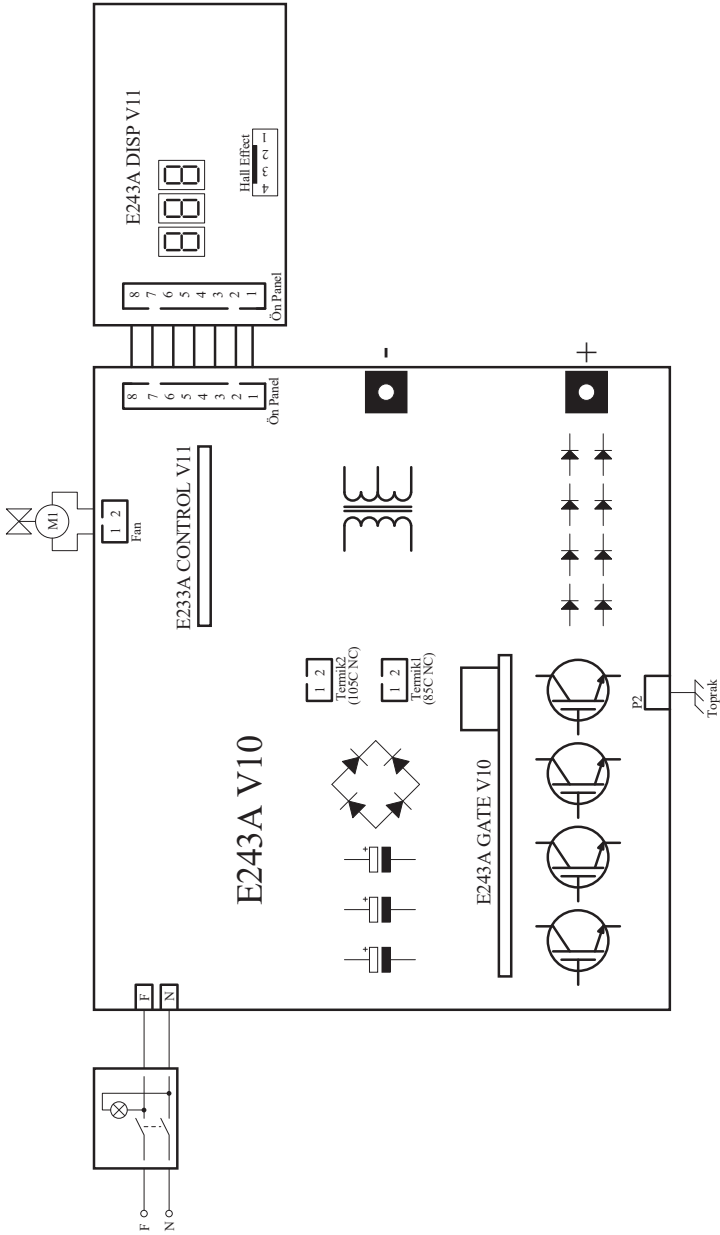

YETKİLİ SERVİSLER

ADANA	BİR ELEKTRİK BOBİNAJI TAHHÜTİCİ Yenişehir Mah. 4615 Sok. No: 2/1. Zemin Kat. Blok No: 18 Seyhan Tel: 0322 429 1070 - Mobil: 0 507 251 95 44	DENİZLİ	AŞ MAKİNA TEKNİK HİRDavat Sarıyıldız Mah. No: 20 Tel: 0258 363 2729	İSTANBUL AVRUPA	KAPITAN TEKNİK MAKİNA Kıyıköy Mah. 39. Sok. No: 11/1 Eskişehir Tel: 0212 699 91 26	MANİSA	GUÇU BOBİNAJ Sarıyıldız Mah. 1208 Blok No: 6 Tel: 0238 333 2400
ADANA	TEK-SER SANAYİ TEKNİK Yeni Sanayi Sitesi 45. Sok. 4. Blok Çarş. No: 23 Seyhan Tel: 0322 429 2392	DENİZLİ	ÖZSEL KAYNAK MAKİNA Sarıyıldız Mah. 1. Sanayi Sitesi 161. Sok. No: 15 Tel: 0258 362 86 66	İSTANBUL AVRUPA	KAYNAK MAKİNA Muharremi Mah. No: 14. Etiler Kat. Osmangazi Sokağı Blok No: 176 Bayrampaşa Tel: 0212 377 43 53	MARDİN	GÖR-AL ELEKTRONİK Erova Mah. 12. Cad. No: 11 C. Çarşıbaşı Tel: 0 482 313 31 45
AFYON	KOÇSARAY SİNAİ VE TİBBİ GAZLAR HİRD. T.C. SAK. LTD. ŞTİ. 1. Sanayi Sitesi 12. Sok. No: 12/A Tel: 0272 213 13 12	DIYARBAKIR	AKTAS BOBİNAJ 1. Sanayi Sitesi 13. Blok No: 1 Yengeçler Muharremi Mah. No: 13/10 409 10 19	İZMİR	AHMET TEZCAN MAKİNA Kavutlar Mah. No: 29 Yeminhalı Tel: 0232 386 65 55	MERSİN	SANTEK STH TEKNİK HİRDAVAT Sarıyıldız Mah. C13 Blok No: 24 Tel: 0324 234 11 14
AKSARAY	AKSARAY ORGANİZE MAKİNA BAKIM Akarsu 03.5. Etiler 03.5. Blok 6. Sok. No: 12 Yagmur Tel: 0308 289 23 39	DÜZCE	BERKE MAKİNA Kavutlar Mah. 75. Sok. No: 8 Tel: 0308 324 92 0	İZMİR	ALP TEKNİK MAKİNA Kavutlar Mah. No: 29 Yeminhalı Tel: 0232 460 65 02	NIĞDE	MİS ELEKTRİK ELEKTRONİK Sarıyıldız Mah. Temiz Enerji Bölgesi Blok. A. Blok No: 48/D Tel: 0380 314 47 29
ANKARA	TEKNİK ADAMLAR No: 29 Yeminhalı Tel: 0312 394 34 48	ELAZIĞ	BULUT ELEKTRİK BOBİNAJ No: 11 Tel: 0242 234 64 79	İZMİR	BEREŞTİ MAKİNE VE SAN. ÜRÜN TEKN. VE TİC. A.Ş. Kavutlar Mah. No: 29 Yeminhalı Tel: 0232 463 52 29	ORDU	ZAFER ELEKTROMEKANİK Kavutlar Mah. No: 29 Yeminhalı 2. Blok 1145 Sok. No: 15/A Tel: 0452 233 12 09
ANTALYA	SONER MAKİNE Yakar Mah. Çarş. Bulvarı No: 117/A Tel: 0242 386 20 25	ERZİNCAN	BANKİRCİOĞLU ELEKTRİK MAKİNA Kavutlar Mah. Semtinde Blok No: 18/4 Tel: 0446 233 99 59	İZMİR	MURATTAN ZAHN MAK. SAN. TİC. LTD. ŞTİ. No: 28 İsmihan Tel: 02324 472 00 38	SAMSUN	AMİS BOBİNAJ Sarıyıldız Mah. No: 3318 Tel: 0362 238 07 23
AYDIN	MAVİ OTOMASYON Marangy Mah. 237 Sok. No: 22/A Nazilli Tel: 0256 319 99 42	ERZURUM	TEKNİK MAKİNA BOBİNAJ Sarıyıldız Mah. 1. Blok No: 66 Kavutlar Tel: 0242 181 17 24	KAYSERİ	FENER METAL SAN. TİC. A.Ş. No: 28 İsmihan Tel: 03523 311 52 54	SAMSUN	YEŞİLDAĞ MAKİNA HİRDAVAT Sarıyıldız Mah. No: 44 Tel: 0362 238 10 82
BALIKESİR	KARESİ KAYNAK MERKEZİ No: 5 Sok. No: 1/A Tel: 0266 246 41 91	ESKİŞEHİR	TEKEL MÜHÜRİSİZ No: 100/35 Saygıncılar Sitesi D Blok No: 8 Tel: 0222 249 42 49	KARAKÖY	ELECTRO-CENTER No: 28 İsmihan Tel: 0242 236 00 96	SİVAS	YALÇINLAR GRİP SİNAİ TİBBİ GAZLAR MAK. Muharremi Mah. No: 15 Sok. No: 1 Tel: 0360 211 26 24
BATMAN	TOPUZ BOBİNAJ Çarşıbaşı Mah. 1533 Sok. No: 35/A Tel: 0488 234 87 20	GAZİANTEP	ÖZDEHİR BOBİNAJ İsmet Paşa Mah. 18. Blok Yengeçler Bölgesi Blok No: 2/B Tel: 0242 231 69 88	KARAMAN	İZİM BOBİNAJ No: 100/35 Saygıncılar Sitesi 14. Blok No: 15 Tel: 0388 213 70 79	ŞANLIURFA	AKSİN BOBİNAJ Sarıyıldız Mah. No: 47 (Etiler Semtinde Akaba) Tel: 0414 314 17 38
BİNGÖL	HEDEF ELEKTRONİK MAKİNA Bahçelievler Mah. Sütlüce Mah. Köy. Cad. No: 47/8 Tel: 0426 236 05 07	HATAY	DIKTAŞ HİRDAVAT Muharremi Mah. Yeni Sanayi Sitesi 893 Sok. No: 4/A Kınkhan Tel: 0226 244 51 93	KARABÜK	ZEDE ELEKTRİK ELEKTRONİK No: 100/35 Saygıncılar Sitesi Blok No: 11/1 Tel: 0370 433 61 61	TEKİRDAĞ	TURAN ELEKTRONİK Yenişehir Mah. Zeynep Mah. Pehlivanpaşa Mah. Kentler Cad. Tel: 0382 673 55 59
BURSA	BİLMER KAYNAK MAKİNE Beşiktaş Mah. Akhisar Cad. Altın Sok. No: 9/11üller Tel: 0226 444 97 86	ISPARTA	TEKNİK EL ALETLERİ VE İNŞAAT MALZEMELERİ No: 17/A İslah Tel: 0246 493 75 45	KIRKLARELİ	GÜVEN ELEKTRİK Sarıyıldız Mah. Saha Binalarında Blok No: 83/F Tel: 0286 615 38 39	TRABZON	DIĞIÇ BOBİNAJ K. Saray Sitesi Saygıncılar Mahallesi Binası Başlangıçta Tel: 0862 252 22 02
BURSA	EKAY KAYNAK No: 100/35 Saygıncılar F.05 Sok. No: 3/5 Yıldırım Tel: 0224 240 00 04	İSTANBUL ANADOLU	ERKOSTEKİ TEKNİK Cod. No: 17/A İslah Tel: 0246 493 75 45	KOCAELİ	ERKOSTEKİ Sarıyıldız Mah. Saha Binalarında Blok No: 83/F Tel: 0286 615 38 39	TRABZON	SARIN BOBİNAJ Sarıyıldız Mah. No: 61 Ortaklar Tel: 0462 325 45 64
BURSA	MAGNESA KAYNAK MAKİNALARI Yenişehir Mah. Çarşıbaşı Cad. No: 4/A İnegöl Tel: 0535 744 06 56	İSTANBUL ANADOLU	ORTEK KAYNAK Erova Mah. İsmet Paşa Sitesi E Blok 503 Sok. No: 29 Ümraniye Tel: 0216 420 73 19	KONYA	MUSTAFA BAŞAK KAYNAK ELEKTROLAR HİRD. TEKS SAN. VE TİC. LTD. ŞTİ. Sarıyıldız Mah. 88. Blok Köygeç Cad. No: 2 Tel: 0232 242 11 11	TOKAT	ULUSU MAKİNE HİRDAVAT Yenişehir Mah. Çarşıbaşı Cad. 5. Sok. No: 14 Tel: 0366 212 47 83
BURSA	ÜLÜDAĞ KAYNAK MAKİNELERİ No: 100/35 Saygıncılar Sitesi 10. Blok No: 10/A Tel: 0224 233 00 01	İSTANBUL ANADOLU	SİSTEKİNK Erova Mahallesi İsmet Paşa Sitesi Blok 88 Blok No: 15/A Tel: 0216 446 69 31	MALATYA	GARANTİ BOBİNAJ Yenişehir Mah. 5047 Cad. 4. Sok. No: 5-6 Tel: 0423 336 42 40	VAN	TÜTÜNÇÜOĞLU LTD. ŞTİ. San. Str. 1. Blok No: 33/14 Tel: 0 482 223 28 26
ÇANAKKALE	EREN BOBİNAJ İsmet Paşa Mah. Saray Sitesi 2. Blok 12. Sok. No: 12 Tel: 0266 233 34 44	İSTANBUL AVRUPA	DEĞİŞİM HİRDAVAT DIŞ. TİC. ŞTİ. Kültür OSB. Demetler Sanayi Sitesi Blok 88 Blok No: 15/A Tel: 0212 401 37 46	MANİSA	MERTHAN TEKNİK MAKİNA 75. YILMAK 3307 Sok. No: 10/1-A Tel: 0535 771 78 89	ZONGULDAK	TÜMEN MAKİNE Ağaç Saray Sitesi D Blok No: 17 Etiler Tel: 0212 252 74 97
ÇORUM	KADEŞLER BOBİNAJ No: 100/35 Saygıncılar Sitesi 23. Cad. No: 2 Tel: 0364 233 23 20	İSTANBUL AVRUPA	İSTİKLAL HİRDAVAT Sarıyıldız Mah. 88. Blok No: 187/A-B Tel: 0212 401 37 46			KIBRIS	ILKAY M. GAÇIÇ LTD. 5. Çarşıbaşı Tel: 0362 366 54 04

İMALATÇI FİRMA

Organize Sanayi Bölgesi 5. Kısım Yalçın Özaras Caddesi No: 1
45030, MANİSA, Türkiye

T: (+90) 236 226 27 28

Made in TÜRKİYE

27.01.2021

UM_MEGAS_072020_012021_002_40



(+90) 444 93 53
magmaweld.com
info@magmaweld.com